## Installation:

1st nut should be spanned with 40 - 45Nm.

2nd nut should shall be brought at least to a snug-tight condition, with special care being given to avoid over-tightening. Nut-marking should be made acc. to figure after torque.


## Maintenance:


Visual inspection of bolt torque and any loose items is made 1 year after installation, and afterwards every 5th year.

Check if the marking from bolt torque is still straight.

Check if the corrosion protection system is satisfactory.

Any findings must be repaired as soon as possible.

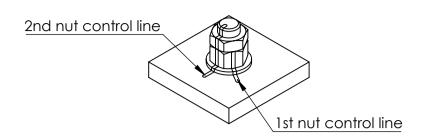

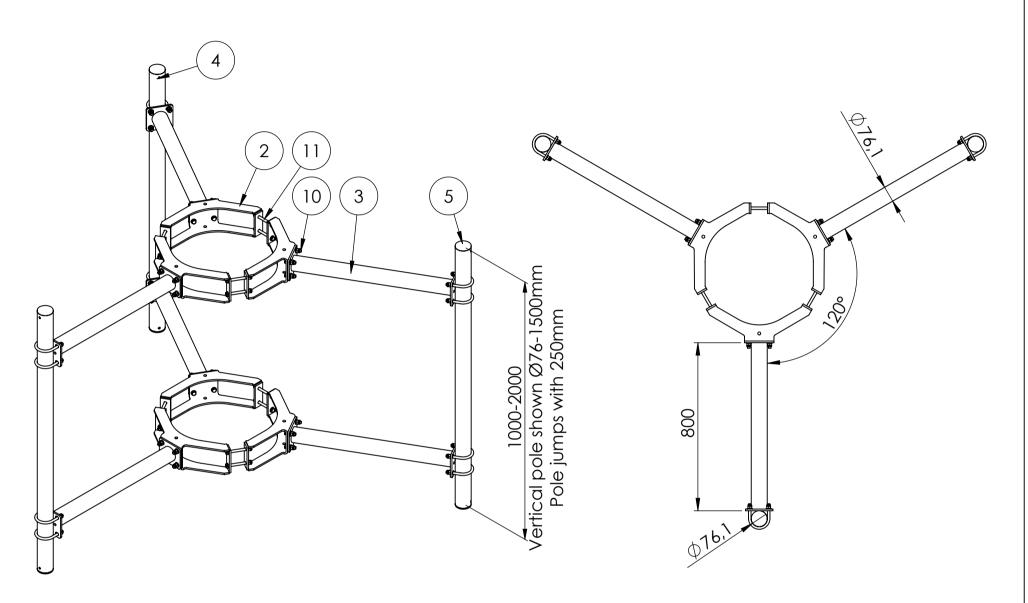

Basic wind Vb,0 = 27 m/s Terrain class TC = 1 Max height of installation = 70m

Max loads per 1 mount pole from equipment: 100kg, CxA=1.0m2

ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
2	VB-Ø455-515	Horizontal bracket version V Ø455- 515	6
3	CVB_H800	Horizontal pole for C and V bracket - Vertical Ø60,3-76,1	6
4	Pole Ø76-1500	Vertical pole Ø76,1 - length: 1500	3
5	GL 76x1.6-4	tubular legs for Ø76,1	6
6	U-bolt M12 C-C = 90		12
7	Washer ISO 7089 - 12		96
8	ISO - 4032 - M12 - W - N		60
9	ISO - 4035 - M12 - N		60
10	ISO 4017 - M12 x 45-N		24
11	ISO 4017 - M12 x 120-N		12

Rev.:	Int.:	Date:		Comment							
		Customer.:									
		Subjekt.:	Antenna offset f. Ø455-515 with fixed brackets								
254		Date.: 2	3-06-2	2020	Production	no.:		Sca	<sup>le.:</sup> 1:18		Format:A3
0	A/ST	Order no.:			Calculation	1:		Int.:	SP/MRF		Projektion:
Ca	Drawing. No.: VB-Ø455-515 H800 Note.:							Tolerance: DS/EN 1090-2			
This drawing is our property and must not be copied, transfered or in any way used by a third party without our written permission  DS/ISO 2768-2-L											
Carl C	A/S M	anufacturing E	nginee	ring Commerc	Smedevej 2	DK-6900	Skjern <sup>-</sup>	Tel. +45 973	51066 Fax	+45 973512	76 www.carl-c.com