Installation:

1st nut should be spanned with 40 - 45Nm.

2nd nut should shall be brought at least to a snug-tight condition, with special care being given to avoid over-tightening. Nut-marking should be made acc. to figure after torque.


Maintenance:


Visual inspection of bolt torque and any loose items is made 1 year after installation, and afterwards every 5th year.

Check if the marking from bolt torque is still straight.

Check if the corrosion protection system is satisfactory.

Any findings must be repaired as soon as possible.

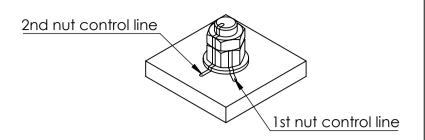

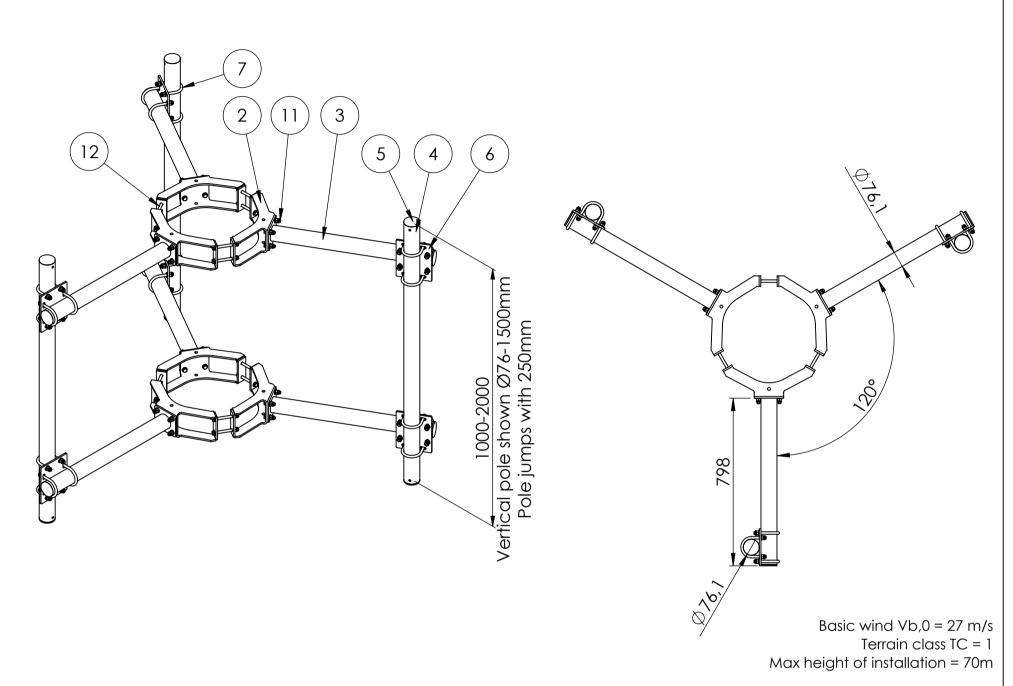

Max loads per 1 mount pole from equipment: 100kg, CxA=1.0m2

ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
2	VB-Ø385-445	Horizontal bracket version V Ø385- 445	6
3	CVBM_H800	Horizontal pole for C and V bracket	6
4	Pole Ø76-1500	Vertical pole Ø76,1 - length: 1500	3
5	GL 76x1.6-4	tubular legs for Ø76,1	12
6	MB-Ø76-76 300	Bracket vertical pole Ø76,1-76,1	6
7	U-bolt M12 C-C = 90		24
8	Washer ISO 7089 - 12		120
9	ISO - 4032 - M12 - W - N		84
10	ISO - 4035 - M12 - N		84
11	ISO 4017 - M12 x 45-N		24
12	ISO 4017 - M12 x 120-N		12

Rev.:	Int.:	Date:		Comment							
	35	Customer.:									
	X	Subjekt.:	Antenna offset 1. 0385-445 with multi dajustable brackets							ets	
		Date.:	23-06-	2020	Production	on no.:		Scale	[:] 1:18		Format:A3
0	A/ST	Order no.:			Calculation	on:		Int.:	SP/MRF		Projektion:
Ca	Drawing. No.: VBM-Ø385-445 H800 Note.:							Tolerance: DS/EN 1090-2			
This drawing is our property and must not be copied, transfered or in any way used by a third party without our written permission DS/ISO 2768-2-L											
Carl C	: A/S M	anufacturing	Engine	ering Commerc	Smedevej	2 DK-6900	Skjern	Tel. +45 9735	1066 Fax +4	-5 9735127	76 www.carl-c.com