Installation:

1st nut should be spanned with 40 - 45Nm. 2nd nut should shall be brought at least to a snug-tight condition, with special care being given to avoid over-tightening. Nut-marking should be made acc. to figure after torque.


Maintenance:

Visual inspection of bolt torque and any loose items is made 1 year after installation, and afterwards every 5th year.

Check if the marking from bolt torque is still straight.

Check if the corrosion protection system is satisfactory.

Any findings must be repaired as soon as possible.

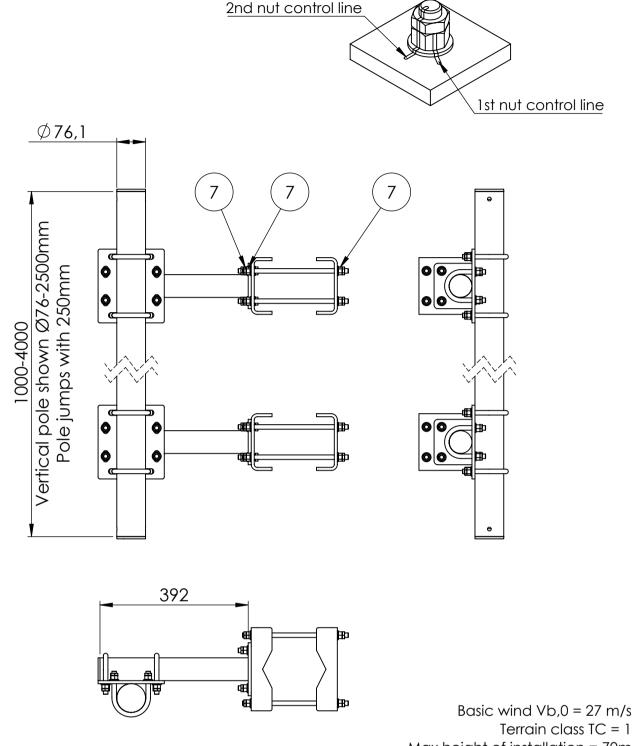

Max height of installation = 70m

Max loads per 1 mount pole from equipment: 150kg, CxA=1.6m2

0					
T and the second		ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
		2	СВ-Ø90-150 300	C bracket Ø90-150	4
Y I		3	CVBM_H400	Horizontal pole for C and V bracke	t 2
		4	U-bolt M12 C-C = 90		4
		5	U-bolt M12 C-C = 75		4
		6	Washer ISO 7089 - 12		44
		7	ISO - 4032 - M12 - W - N		40
		8	ISO - 4035 - M12 - N		40
		9	ISO 4017 - M12 x 45-N		8
		10	M12x280 DIN976	Horizontal pole bracket pin-bolts	8
		11	Pole Ø76-2500	Vertical pole Ø76,1 - length: 2500	1
		12	GL 76x1.6-4	tubular legs for Ø76,1	2
		13	MB-Ø60-76 300	Bracket vertical pole Ø60,3-76.1	2
		14	GL 60x3-5	tubular legs for Ø60,3	2
Rev.: Int.:	Date:		Comment	•	
	Cus	tomer.:			
SK	Subj	^{bjekt.:} Antenna offset f. Ø90—150 with multi adjustable brackets			5
Da		e.: 25-06-2020 Production no.:		Scale.: 1:10	Format:A3
AIST	Orde	er no.:	Calculation:	31 / 1/1/1/1	Projektion:+(
		wing. No.: CBM-Ø90-150 H400 is our property and must not be copied, transfered or in any way used b		Note.: Tol DS	Tolerance: DS/EN 1090-2 DS/ISO 2768-2-
Carl C A/S	-			900 Skjern Tel. +45 97351066 Fax +45 97351276	

